



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

D205-634-145
Job Sheet 186082



Part No: D205-634-145

Job Qty: 1 ea

Part Name: Replacement Skidtube with Thru-Bolt Standard Wearplates Fits LH or RH



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 11/9/18

Job Tracking No:

Due Date: 11/30/18

Created By: Marie Lajeunesse

Type: SOLD

Description:

Note: DWG D2580-049 REV H, IIN-D205-634 REV I IPP REV:B 14.04.21 NEW ISSUE DD VERF:JLM

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		11/30/18	0.00	0.00	Start Up Skidtubes-1		mg.6
110	Skidtubes	1 pcs		11/30/18	0.00	2.01	Skidtubes-2		mg.6
120	CNC Bend Skidtubes	1 pcs		11/30/18	0.49	0.60	CNC Bend Skidtube		mg.6 TF
130	Skidtubes	1 pcs		11/30/18	0.00	2.01	Skidtubes-2		DD
140	QC	1 pcs		11/30/18	0.00	0.00	QC5		DD
150	Skidtubes	1 pcs		11/30/18	0.00	2.01	Skidtubes-2		DD
160	QC	1 pcs		11/30/18	0.00	0.00	QC10		38 DAS
170	QC	1 pcs		11/30/18	0.00	0.00	QC5		9-89 38
180	HandFinish	1 pcs		11/30/18	0.00	1.07	HandFinish2		D.R. 18/11/21
190	Powdercoat	1 pcs		11/30/18	0.00	0.18	Powdercoat1		BL 18-11-22
200	QC	1 pcs		11/30/18	0.00	0.00	QC3		14 18-11-22
210	HandFinish	1 pcs		11/30/18	0.00	1.07	HandFinish4		24 18-11-22
220	QC	1 pcs		11/30/18	0.00	0.00	QC5		DAS 21
225	DC	1 pcs		11/30/18	0.00	0.00	DC		NOV 2 8 2018 68
230	Packaging	1 pcs		11/30/18	0.00	0.00	Packaging3-1		NOV 2 8 2018 9-89
240	QC21-FG	1 Ea		11/30/18	0.00	0.00	QC21		NOV 2 8 2018 21

Part Op 110 - 1- PICK D2580-1 2- SPOT DRILL 2 AFT RUN ON WEARPLATE HOLES USING DT10021, DRILL 3.630" HOLES

Descriptions: USING DT8462 (83.94" FROM AFT OF D2580-1 REF. ONLY)

120 - 1-Bend as per program D2580 SKID on CNC Bender and Folio FT 16 2-Cut tubes as per Dwg. D2580 3- Scribe batch# in aft end of tube

130 - 1-Deburr ends after cutting and remove bending marks. Prepare tube for welding D2576-3 step remove alodine as required. 2-Locating from most fwd saddle hole, drill most fwd wearplate hole using DT9793 (10.832 REF) as per dwg D2580 sheet 7. 3-Open run-on wearplate holes to finished size 0.508" at locations (5.338/ 5.985/ 10.832/ 3.63 REF) as per dwg D2580 sheet 7. 4-Drill pilot holes for aft cap using DT8215, Open to finished size.

150 - 1-Weld step D2576 as per Dwg. D2580 and QSI 004 A/R Aluminum Rod _____ - Grind welds flush. 2-Touch up alodine on run on wearplate holes prior to swaging 3- Insert D4202-1 spacer, swage as per QSI002 and trim/ grind flush per QSI002 and as per dwg 4-DRILL TOWING HOLE USING DT8091 5-DEBURR

180 - Realodine tube as per QSI 005

190 - START TIME: 8:25 OVEN TEMPERATURE: 320 FINISH TIME: 8:55

210 - 1-Install inserts & wearplates as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates A/R Sikaflex-291 _____ Sikaflex expire date: _____ 2-Coat D2594-3 O' rings with

220 - Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

225 - Photocopy D205-634 bluefile & type labels per PPP D205-634-145 CHG001

230 - Identify and pack for shipping as per PPPD205-634-145 Location : FG073

AIR
138673
MB 8951

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Job BOM

006615

Part / Item	Component Name	Quantity	Operation	Container
D2580-1	205 Bent Tube	1 Ea (1 ea)	90-Start up Operation	5120873
AN3-5A	Bolt	2 Ea (2 ea)	210-HandFinish	5095480
AN4-45A	Bolt	8 Ea (8 ea)	210-HandFinish	50701922
D2570	Bushing	16 Ea (16 ea)	210-HandFinish	5108649(x14)
D2576-3	Step (Machining Detail)	1 Ea (1 ea)	210-HandFinish	5089827
D2594-1	Plug	8 Ea (8 ea)	210-HandFinish	5120401
D2594-3	O-Ring	8 Ea (8 ea)	210-HandFinish	5106792
D2855	Cap	1 Ea (1 ea)	210-HandFinish	5066018
D4202-1	Spacer	24 Ea (24 ea)	210-HandFinish	5121344
D5061-1	Fwd Wearplate	1 Ea (1 ea)	210-HandFinish	5079400
D5061-3	Aft Wearplate	1 Ea (1 ea)	210-HandFinish	5084711
MS21042-4	Nut	8 Ea (8 ea)	210-HandFinish	5038763
NAS1149D0332J	Washer	2 Ea (2 ea)	210-HandFinish	5100467

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D2580-1	1	1	0
210-HandFinish	AN3-5A	2	314	0
	AN4-45A	8	131	0
	D2570	16	117	0
	D2576-3	1	38	0
	D2594-1	8	160	0
	D2594-3	8	472	0
	D2855	1	92	0
	D4202-1	24	366	0
	D5061-1	1	4	0
	D5061-3	1	3	0
	MS21042-4	8	96	0
	NAS1149D0332J	2	1,945	0

Part Specifications

Specifications could not be found.

Plex 11/9/18 1:33 PM Dart.lajeunesse.marie

12/11 Northrup Street
Hawkesbury, ON K6A 1K7
CANADA
TEL: 1 613 832-5200
Email: sales@dartero.com
www.darterospac.com

DAKI
AEROSPACE

Container No: S128387



Part: D205-634-145

Job No: 186082

Serial No/Batch: S128387

Revision:

Inspector:

Exp Date:

Instructions: TC STC SH96-88 Issue 3, FAA-ATC SR00563NY 08/08/11, EASA S

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER :							

ITEM	QTY -041	QTY -045	QTY -047	QTY -049	PART NUMBER	DESCRIPTION
1	X				D2580-041	SKIDTUBE ASSEMBLY
2		X			D2580-045	SKIDTUBE ASSEMBLY
3			X		D2580-047	SKIDTUBE ASSEMBLY
4				X	D2580-049	SKIDTUBE ASSEMBLY
20	1	1	1	1	D2500-1-190	EXTRUSION
21			16	16	D2570	BUSHING
22	1	1	1	1	D2576-3	STEP
23		4			D2579	SPACER
24	16	16	8	8	D2594-1	PLUG
25	16	16	8	8	D2594-3	O-RING
26	1	1	1	1	D2596	205 WEB
27	1	1	1	1	D2855	AFT CAP
28	1	1			D3564-5	WEARSHOE
29	1	1			D3564-9	WEARSHOE
30	1	1			D3564-11	WEARSHOE
31	1	1			D3564-13	WEARSHOE
32	20	20	24	24	D4202-1	SPACER
33			1		D4406-041	WEARPLATE ASSEMBLY
34			1		D4408-043	WEARPLATE ASSEMBLY
35				1	D5061-1	FWD WEARPLATE
36				1	D5061-3	AFT WEARPLATE
60	50	50			ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
51	50	50			AN3C4A	BOLT
52	2	2	2	2	AN3-6A	BOLT
53			8	8	AN4-45A	BOLT
54	50	50			NAS1149C0332R	WASHER (AN980C10L)
55	2	2	2	2	NAS1149D0332J	WASHER (AN980JD10L)
56			8	8	MS21042-4	NUT (OR MS21042L4)

GENERAL NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT (-041/-047/-049) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
POWDER COAT (-045) GREEN SANDTEX (REF 4.3.5.8) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D2580-041 = 33.7 lbs
D2580-045 = 33.7 lbs
D2580-047 = 45.1 lbs
D2580-049 = 32.0 lbs
- 8) WELDING PER DART QSI 004.
- 9) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 10) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 11) USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL 20.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241-281.
- 12) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047/-049)
- 13) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 186082 MWS
18-11-05


RELEASED

2017 JUL 05 4
BENIT-569


H	SHEET: PL DELETE D3566-1/-5/-13 GASKETS, WEIGHTS UPDATED ACCORDINGLY. SHEETS 2 & 4 PICTORIAL UPDATE FOR REMOVAL OF GASKETS	SAD	17.06.09
G	ADDED -049, -047 WEIGHT UPDATED PER DSI 9596	AJS	14.04.09
F	INCORPORATE DEO D2580-E-1 PER PAR12-218	DC	13.06.20
E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 8124/ 9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	06.06.26
B	AS MANUFACTURED	DS	06.12.02
A	NEW ISSUE	DS	06.06.16
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	JS	DRAWING NO.	REV. H
MFG. APPR.	JS	D2580	SHEET 1 OF 9
APPROVED	JS	TITLE	SCALE
DE APPR.	JS	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

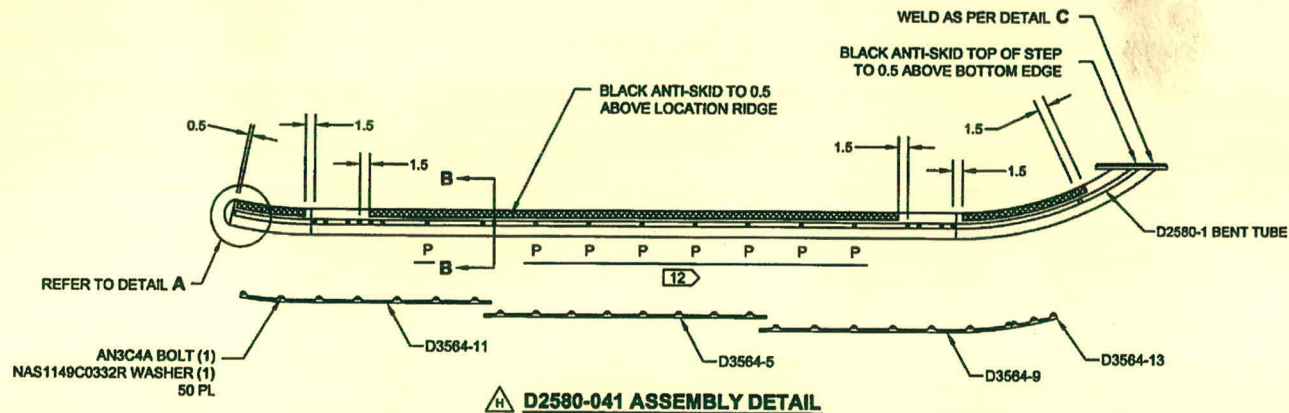

DETAIL A
SCALE 5X

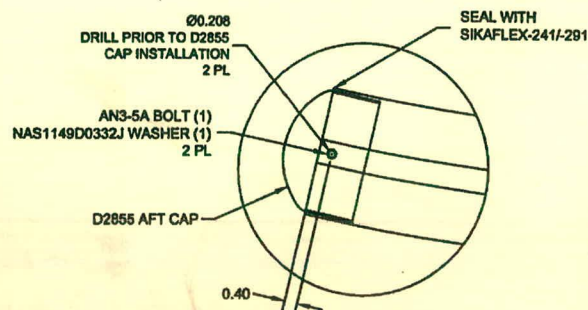


SECTION B-B
SCALE 5X

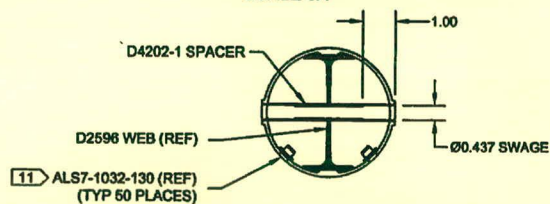


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (20 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002

DETAIL C
SCALE 5X

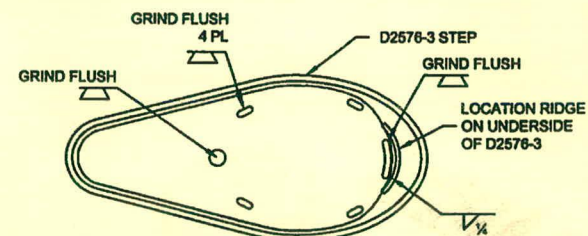

RELEASED
2017 JUL 05


DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO. D2580	REV. H SHEET 2 OF 9
MFG. APPR.	<i>[Signature]</i>	TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
APPROVED	<i>[Signature]</i>	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DE APPR.	<i>[Signature]</i>		
DATE	17.06.09		

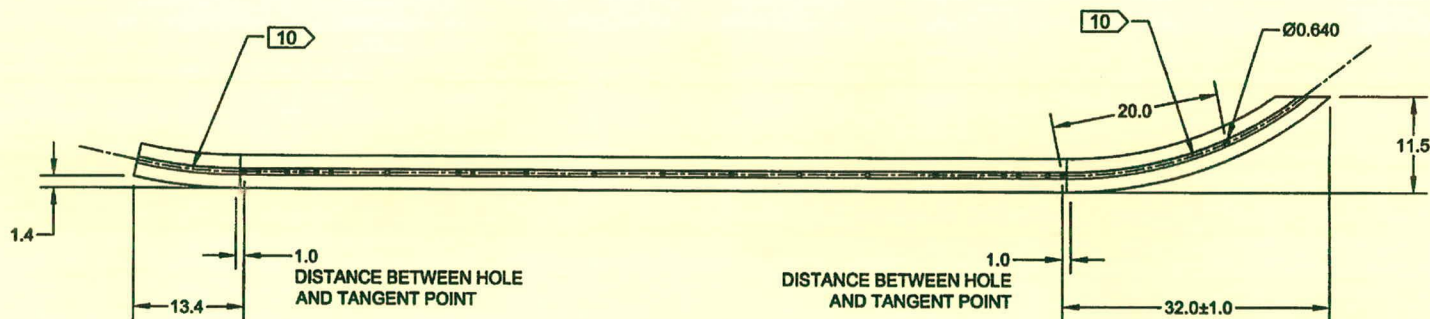

D2580-1 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2017 JUL 05 *47*

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 3 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	



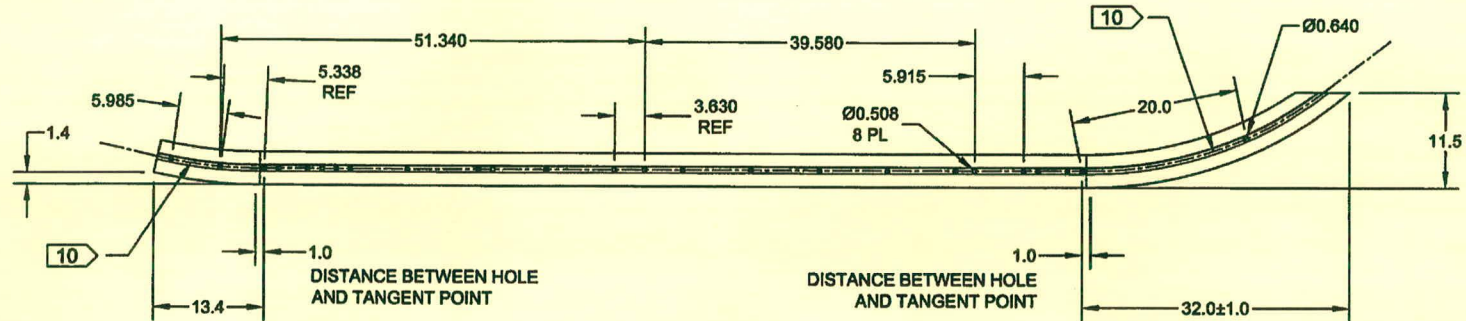


D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED


2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 5 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

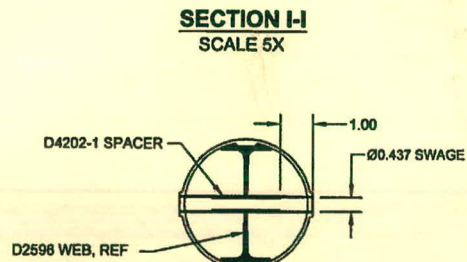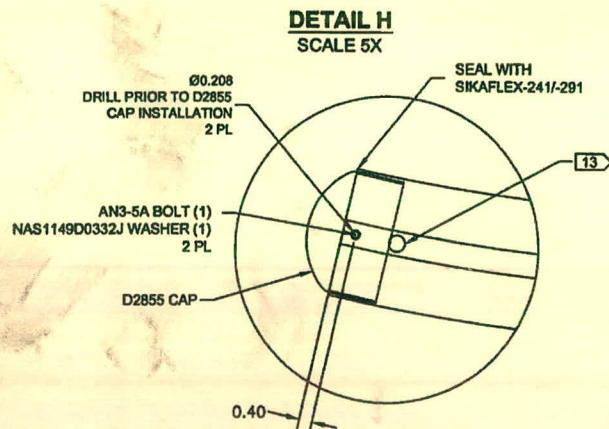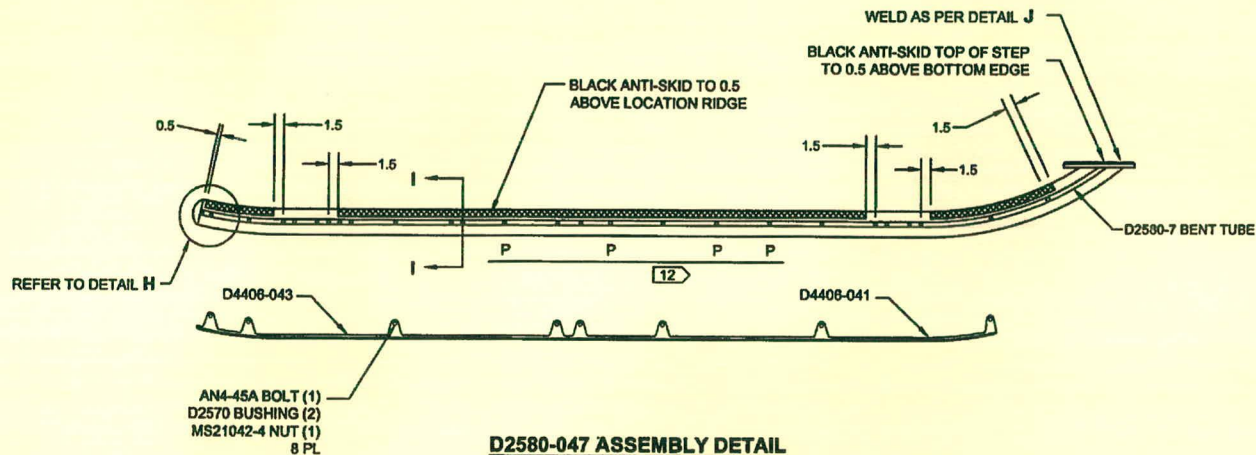

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:





1. INSERT D4202-1 SPACER (24 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

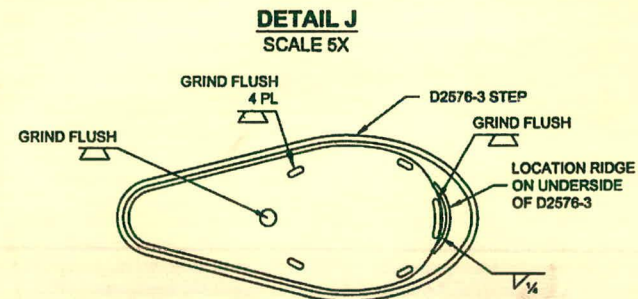

RELEASED

2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO. D2580	REV. H
MFG. APPR.	<i>[Signature]</i>		SHEET 8 OF 9
APPROVED	<i>[Signature]</i>	TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
DE APPR.	<i>[Signature]</i>		
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE SUPPLIER'S CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

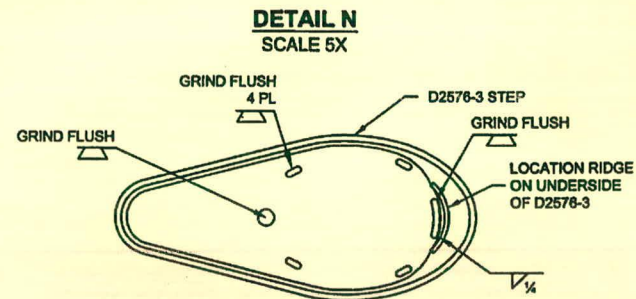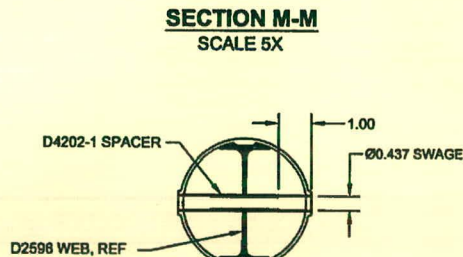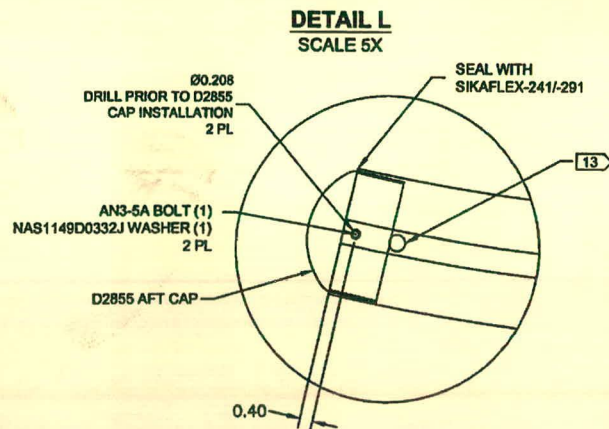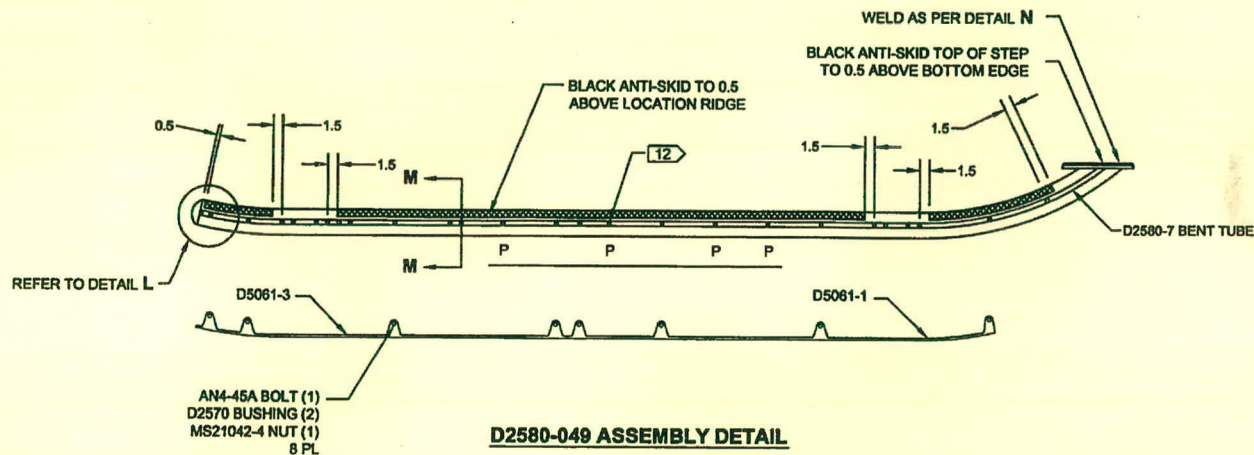


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (24 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

RELEASED

2017 JUL 05


DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO. D2580	REV. H
MFG. APPR.	<i>[Signature]</i>		SHEET 7 OF 9
APPROVED	<i>[Signature]</i>	TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
DE APPR.	<i>[Signature]</i>		
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

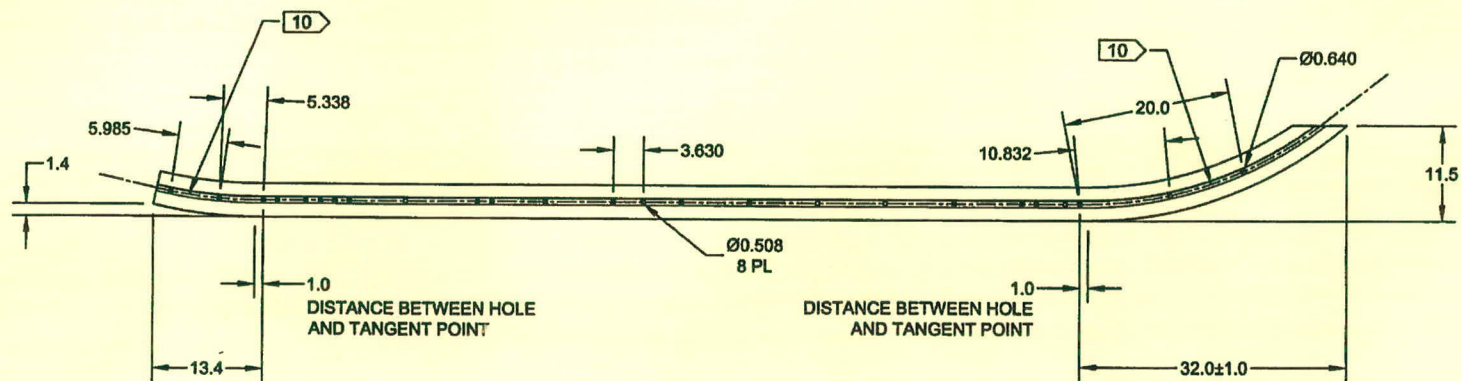


D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2017 JUL 05 *dp*

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO. D2580	REV. H SHEET 8 OF 9
MFG. APPR.	<i>[Signature]</i>	TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
APPROVED	<i>[Signature]</i>	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DE APPR.	<i>[Signature]</i>		
DATE	17.06.09		

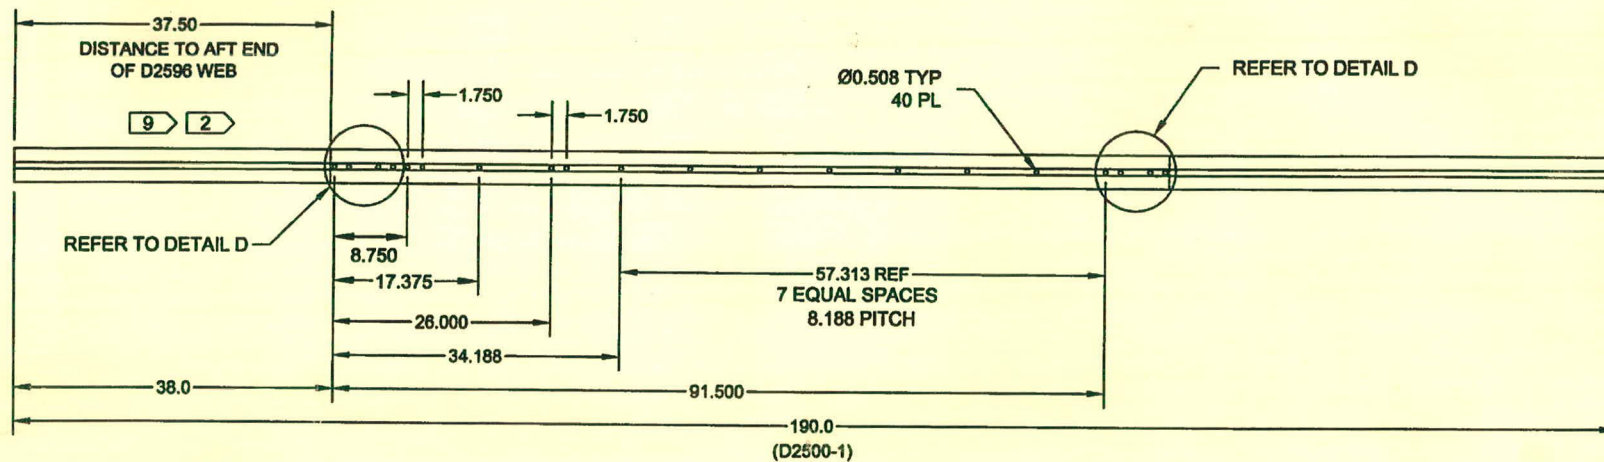

D2580-101 TUBE

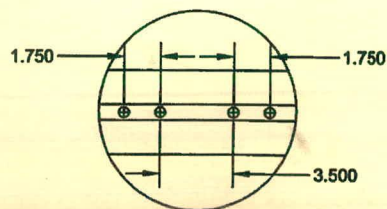

DETAIL D
SCALE 5X

RELEASED

2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 9 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1986 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8

7

6

5

4

3

2

1

